



Art.-Nr: AMR401WL-AZ Exit sign Single Battery Recessed wall mounting, Wireless Professional, 1 h, 22 m, IP40, Zinc die-cast, Anthracite

The AMR is a zinc-diecast exit sign for recessed wall mounting and for the marking of escape routes. It is part of a complete luminaire series, which features solutions for every mounting situation and was honored with the German Design Award. Luminaires of the A-Series are equipped with modern LED illuminants and offer flexibility with changeable pictograms.

LED exit sign according to EN 60598-1, EN 60598-2-22, EN 7010 and EN 1838



TECHNICAL DATA

Luminaire type	Exit sign
Mounting	Recessed wall mounting
Recognition distance	22 m
Pictograph	Set
Illuminant	LED
Housing material	Zinc die-cast
Housing color	Anthracite
Protection type (IP)	IP40
Impact resistance (IK)	≥ 3
Certification	WEEE, CE, ENEC
Insulation class	2
Supply	Single Battery
Monitoring	Wireless Professional
Bridging time	1 h
Battery	LFP3212.K-SET-2AKKU
Operating mode	Standby circuit / permanent circuit
Input voltageAC	230 V
Input frequency	50 Hz
Power max.	4,7 W
Power DS	3,5 W



More information








Power BS	0,8 W
Ambient temperature DS	-5 °C - 40 °C
Ambient temperature BS	-5 °C - 40 °C
Depth	79 mm
Width	236 mm
Height	151 mm
Installation length	176 mm
Installation width	68 mm
Installation height	40 mm
Weight	1.17
Weight incl. packaging	1.53
Connection cross-section	2.5 mm²
Switching input	Yes
Emergency light blocking	Yes
Battery connection	Connector
Dimming function	Yes
Customs tariff number	94056180
EAN	4260682153289





TECHNICAL DRAWING

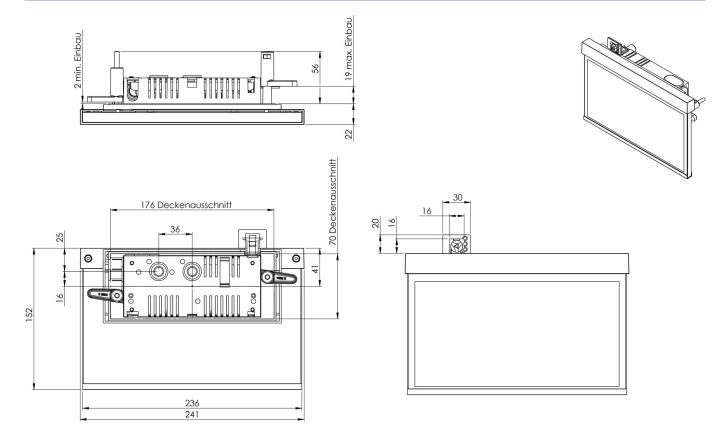

ACCESSORY LIST

BALLPLX-AM -

AM-XBE -

LFP3212.K-SET-2AKKU - LiFePO4 Battery





RELATED PRODUCTS

ArtNo.	Image	Monitoring	Supply	Color	Investment	Automatic log	Maintenance level	Remote maintenance	max. Iuminaires	Single luminaire monitoring
AMR401WL		Wireless Professional	Single battery		€€	yes	low	yes	1,000 per system	central
AMR401WL- E		Wireless Professional	Single battery		€€	yes	low	yes	1,000 per system	central

As of: 16.07.2024 - Subject to technical changes and errors.